

Technical Bulletin

Model

All

Group

2

Subject: Spark Plug Thread Lubrication


Part Identifier
2870

Number
9102

ATTENTION: Service Manager/Service Technician

This bulletin supersedes Technical Bulletin Group 28, Number 78-03, Book A, page 297.

Models Affected: *All*

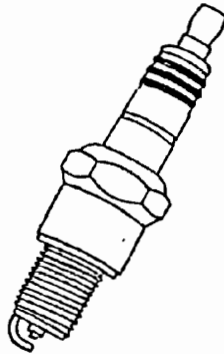

Concern:

Spark plug thread lubrication.

Service Information:

The Carrera 2/4 Workshop Manual Vol. 1, page 03-11, in the section on replacing spark plugs states "Do not use any lubricant on the (spark) plug threads."

This procedure now applies retroactively to all Porsche models. All spark plugs should be installed with the threads clean and dry.

The torque specification is unchanged: 25-30 Nm (19-22 ft. lb.).

PORSCHÉ CARS NORTH AMERICA, INC.

