

Technical Bulletin

Model
911

Group
1

Subject
Crankcase Cylinder Studs

Part Identifier
1012


Number
9604

ATTENTION: Service Manager / Service Technician

Models Affected: *All 911 models using Dilavar cylinder head studs.*

General Information: The Dilavar cylinder head stud, part number 930 101 170 02, has been superseded to cylinder head stud, part number 993 101 170 51.

Repair Information: The following precautions should be followed when using the new version cylinder head stud:

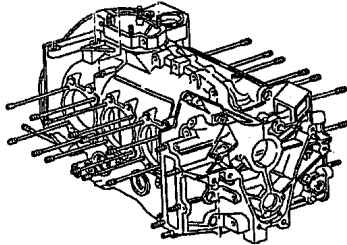

1. The new version cylinder head stud is micro-encapsulated with a stud locking compound, therefore, when installing the stud into the engine case, the threaded portion of the case must be clean of debris and oil free. If necessary, chase the threaded hole for the cylinder head stud with a tap.
2. There is no change in torque specifications for the cylinder heads and no change in the cylinder head nut.
3. The new cylinder head stud can be used for individual replacement. It is not necessary to replace the cylinder head stud in groups.

Installation:

Model and Year

Installation Height

911 Carrera (993)	130.2 mm -5 mm
911 Carrera 2/4 (964)	130.2 mm -5 mm
911 Carrera up to 1989	135 mm

Parts Information:

New Version

Former Version (Dilavar)

993 101 170 51	930 101 170 02 (not available)
----------------	--------------------------------

Important Notice: Porsche Cars N.A Technical Bulletins are intended for use by professional technicians, not a "Do-it-yourselfer." They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Special tools may be required to perform certain operations identified in these bulletins. Use of tools and procedures other than those recommended in these bulletins may be detrimental to the safe operation of your vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your Porsche Dealer for information on whether your vehicle may benefit from the information. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify correct part numbers. ©1996 Porsche Cars North America, Inc.

Dealership	Service Manager _____	Shop Foreman _____	Service Technician _____	_____	_____	_____	_____
Distribution	Asst. Manager _____	Warranty Admin. _____	Service Technician _____	_____	_____	_____	_____
Routing							

The trademarks Porsche®, Targa®, Carrera®, Tiptronic®, Varioram® and the Porsche Crest are registered trademarks of Dr. Ing. h.c.F. Porsche AG and its affiliate, Porsche Cars North America, Inc.

©1996 Porsche Cars
North America, Inc.
All rights reserved. Cannot be
reproduced without written permission.
Service & Parts Publications.



SERVICE

Page 1 of 1
November 7, 1996