

Technical Bulletin

Model 911 Carrera 4	Group 3
Part Identifier 3572	Number 9001


Subject: Second Gear Markings

ATTENTION: Service Manager/Service Technician

Model: 911 Carrera 4

Condition: For tolerance reasons, the second speed free wheeling gear is marked with one or two white paint dots. The needle bearings with inner races are matched accordingly.

- Repair Instructions:**
- When replacing needle bearings: the free wheeling gear with one paint dot requires needle bearing PN 999 201 367 00. The free wheeling gear with two paint dots requires needle bearing PN 999 201 368 00.
 - When replacing second gear set, PN 964 302 902 30 includes needle bearing and inner race.
- Note:** The needle bearings are not marked.

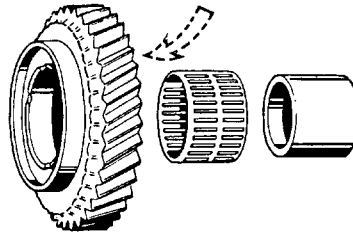

PORSCHE CARS NORTH AMERICA, INC.

Dealership _____ Service manager _____ Shop foreman _____ Service technician _____
Distribution _____
Routing _____ Asst. manager _____ Warranty admin. _____ Service technician _____

©1990 Porsche Cars
North America, Inc.
All Rights Reserved
Porsche Service
Publications



SERVICE

Page 1 of 1
February 2, 1990